


Type Herst.	WE 26 Mar
U_f	4
I_f	1,1
Heizart	~
Verw.	w
Kbn-Lg.	—
Kbn-Ø	—
U_a	200 ¹⁾
U_{g6}	—
U_{g4}	—
U_{g3}	—
U_{g2}	33
U_{g1}	-2,3
I_a	0,35
I_{g2}	0,1
S	—
D	—
R_i	2500
R_b	6
R_a	300
R_{g3}	—
$U_{g1} \sim$	—
V	150
$N_a \sim$	—
U_b max	250
U_{g2} max	150
N_a max	1
N_{g2} max	0,25
R_{g1} max	2
$c_{g/a}$	<0,003

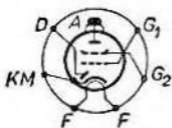

WE 26