


Type Herst.	WG 34 OL	
U_f	50	
I_f	0,18	
Heizart	\cong	
Verw.	A	EP
Kbn-Lg.	—	
Kbn- \emptyset	—	
U_a	200 ¹⁾	200
U_{g5}	—	—
U_{g4}	—	—
U_{g2}	—	—
U_{g2}	30	200
U_{g1}	-1,5	-8
I_a	0,35	40
I_{g3}	0,08	7
S	1	4,5
D	3,5 ⁶⁾	10 ⁶⁾
R_i	2000	45
R_k	—	0,18
R_a	350	9
R_{g2}	2500	—
$U_{g1} \sim$	—	—
V	2000	200
$N_a \sim$	—	3,5
U_b max	300	300
U_{g2} max	100	250
N_a max	0,5	8
N_{g2} max	0,5	2,5
R_{g1} max	—	—
$C_{g/a}$	0,1	—

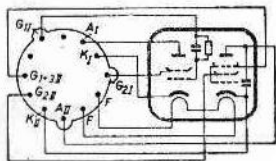

WG 34